



Under Test: TC4013-8
S/N: 1319189
Reference: TC4033
Date: 2019-08-21
Session, Run: 32686, 3
Max RR: -217.8 dB re 1 μ Pa/V at 1m
SL Right: 25.0°, 0.0dB dB re 1 μ Pa/V at 1m
Comment: Horizontal.

HYDROPHONE DIRECTIVITY


Amplitude: 20.0 Vrms
Pulse Width: 166.7 μ s
Angle: -180.0° to 180.0°
Frequency: 90.00 kHz

PR10.2 (10 de 12) Description
des travaux 2020

Temperature: 23.17°C
Depth: 1.2 m
Distance: 0.50 m
Tested by: PRA

22 AUG. 2019
POS OK

For all mats:
2019-08-21 PRA

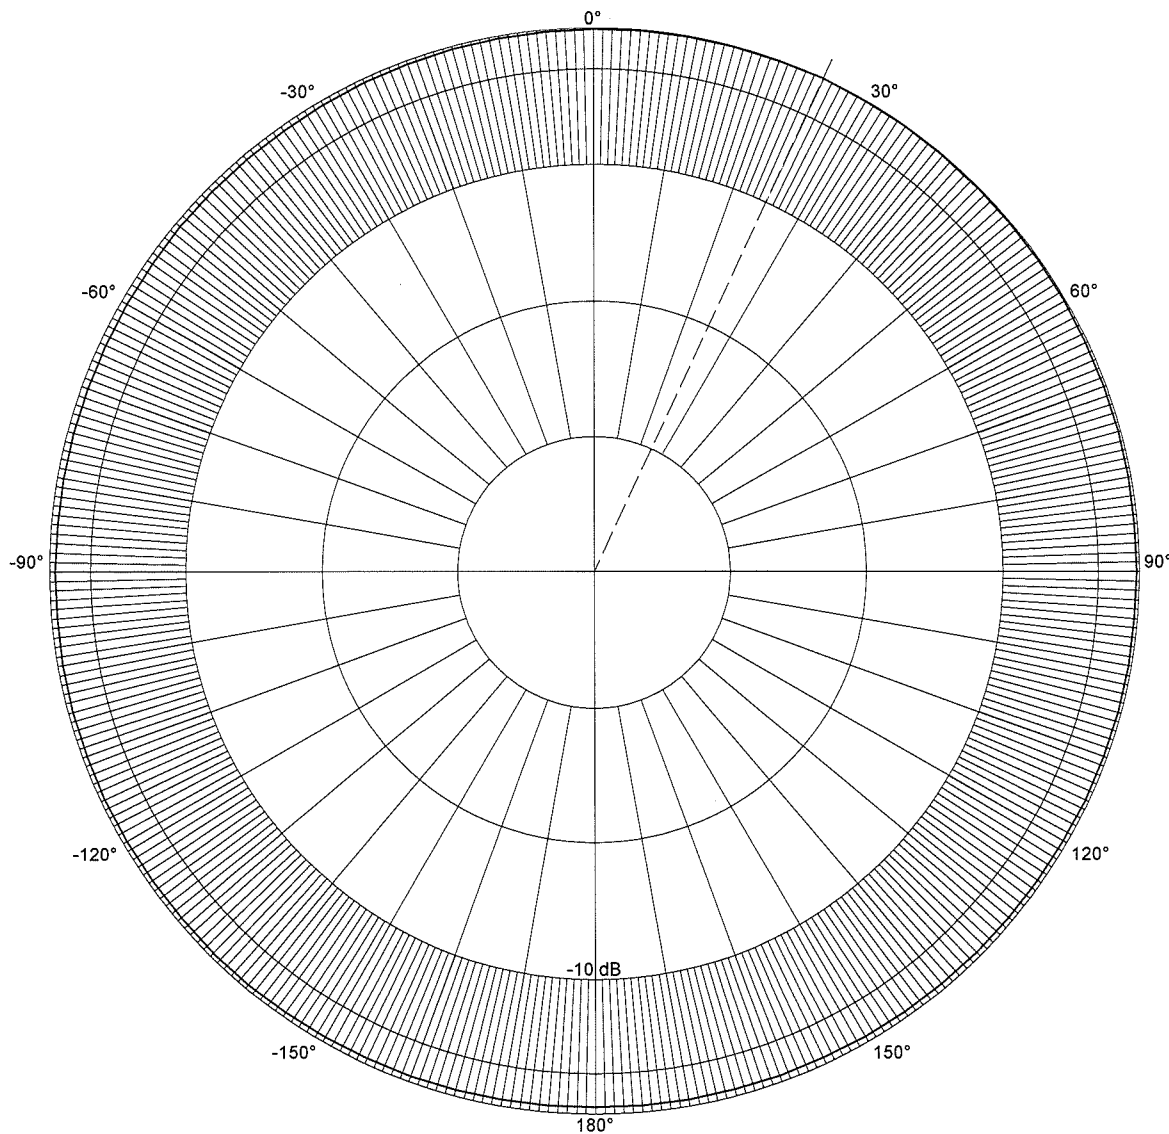




HYDROPHONE DIRECTIVITY

Under Test: TC4013-8
S/N: 1319189
Reference: TC4033
Date: 2019-08-21
Session, Run: 32686, 2
Max RR: -216.4 dB re 1 μ Pa/V at 1m
W: 341.6°
Comment: Vertical.

Amplitude: 10.0 Vrms
Pulse Width: 166.7 μ s
Angle: -180.0° to 180.0°
Frequency: 90.00 kHz

Temperature: 23.17°C
Depth: 1.2 m
Distance: 0.50 m
Tested by: PRA

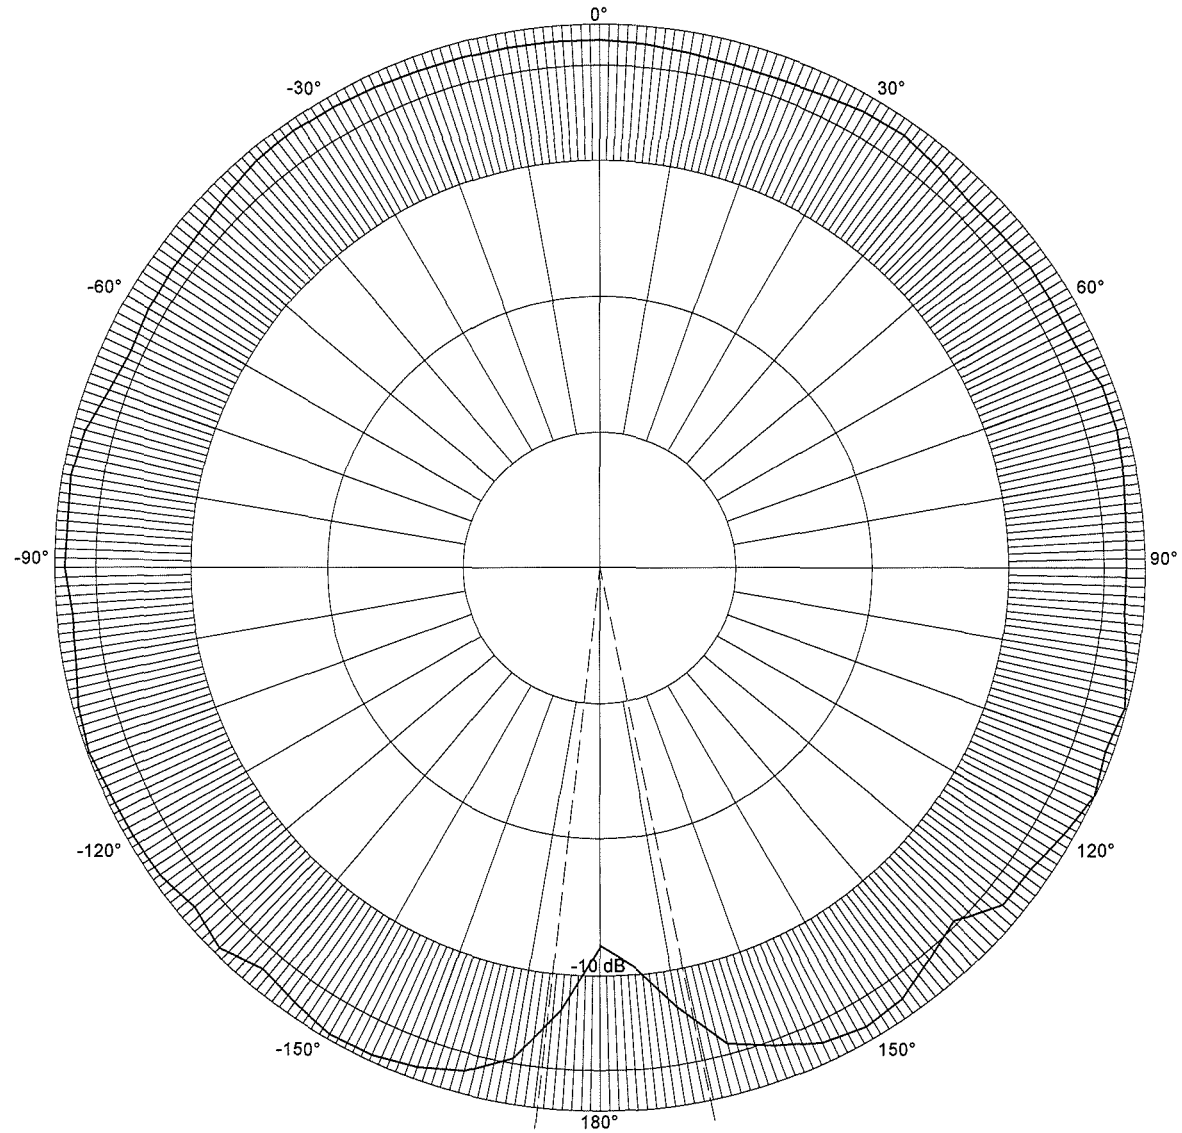




HYDROPHONE SENSITIVITY

Under Test: TC4013-8
S/N: 1319189
Reference:
Date: 2019-08-21
Session, Run: 32686, 4
Comment:

Amplitude: 70.0 Vrms
Pulse Width: 1400.0 μ s
Rep Rate: 66.7 ms
Averages: 8

Temperature: °C
Depth: 0.0 m
Distance: 0.00 m
Tested by: PRA

PHO @ 250 Hz: -217.2 dB.

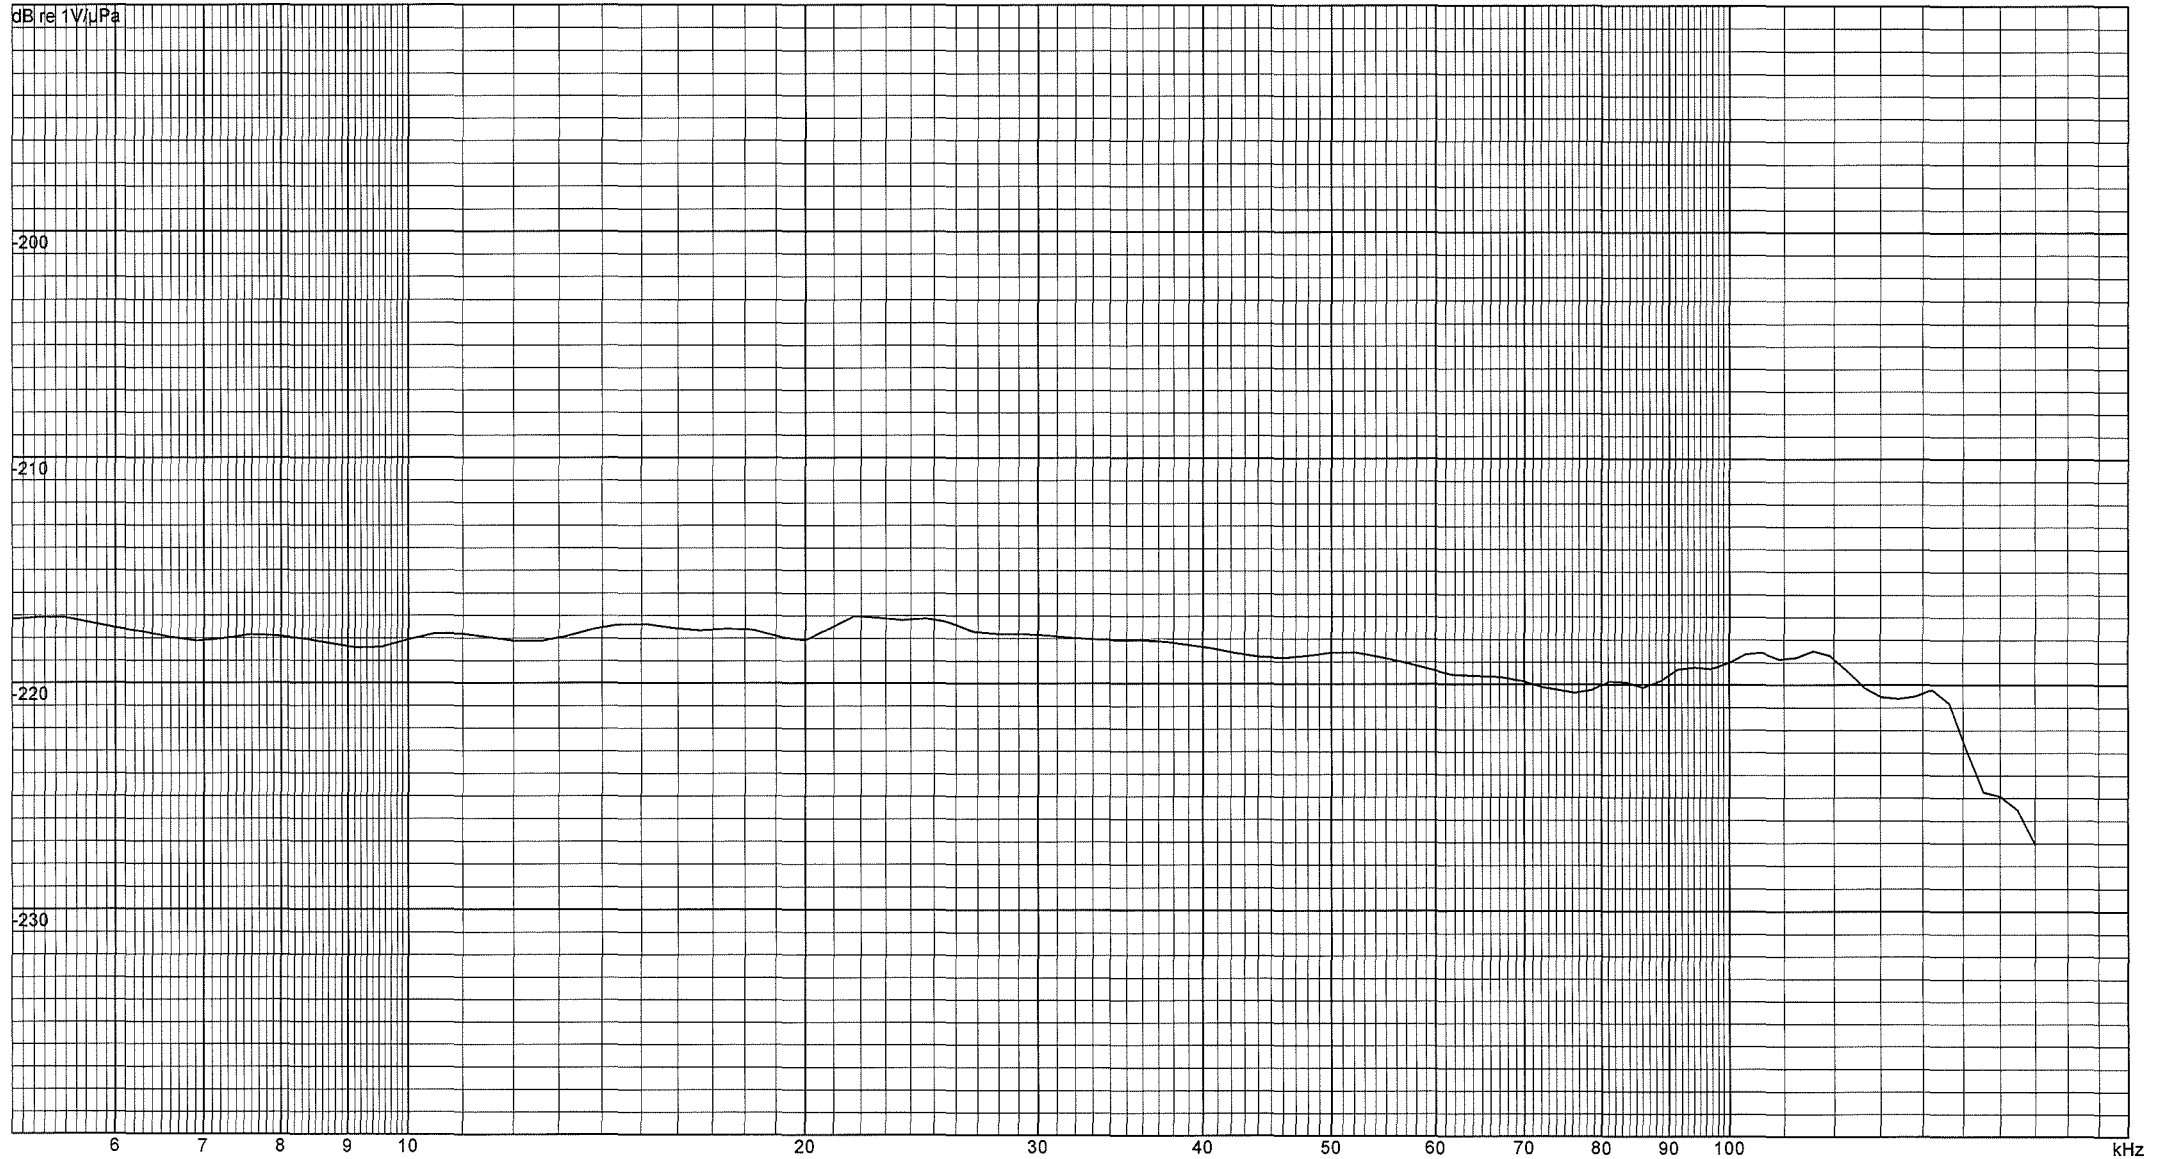




Under Test: TC4013-8
S/N: 1319189
Reference:
Date: 2019-08-21
Session, Run: 32686, 7
100.00 kHz: 132.03 dB re 1 μ Pa/V at 1m
Comment:

PROJECTOR SENSITIVITY

Amplitude: 9.5 Vrms
Pulse Width: 1400.0 μ s
Rep Rate: 100.0 ms
Averages: 8

Temperature: °C
Depth: 0.0 m
Distance: 0.00 m
Tested by: PRA

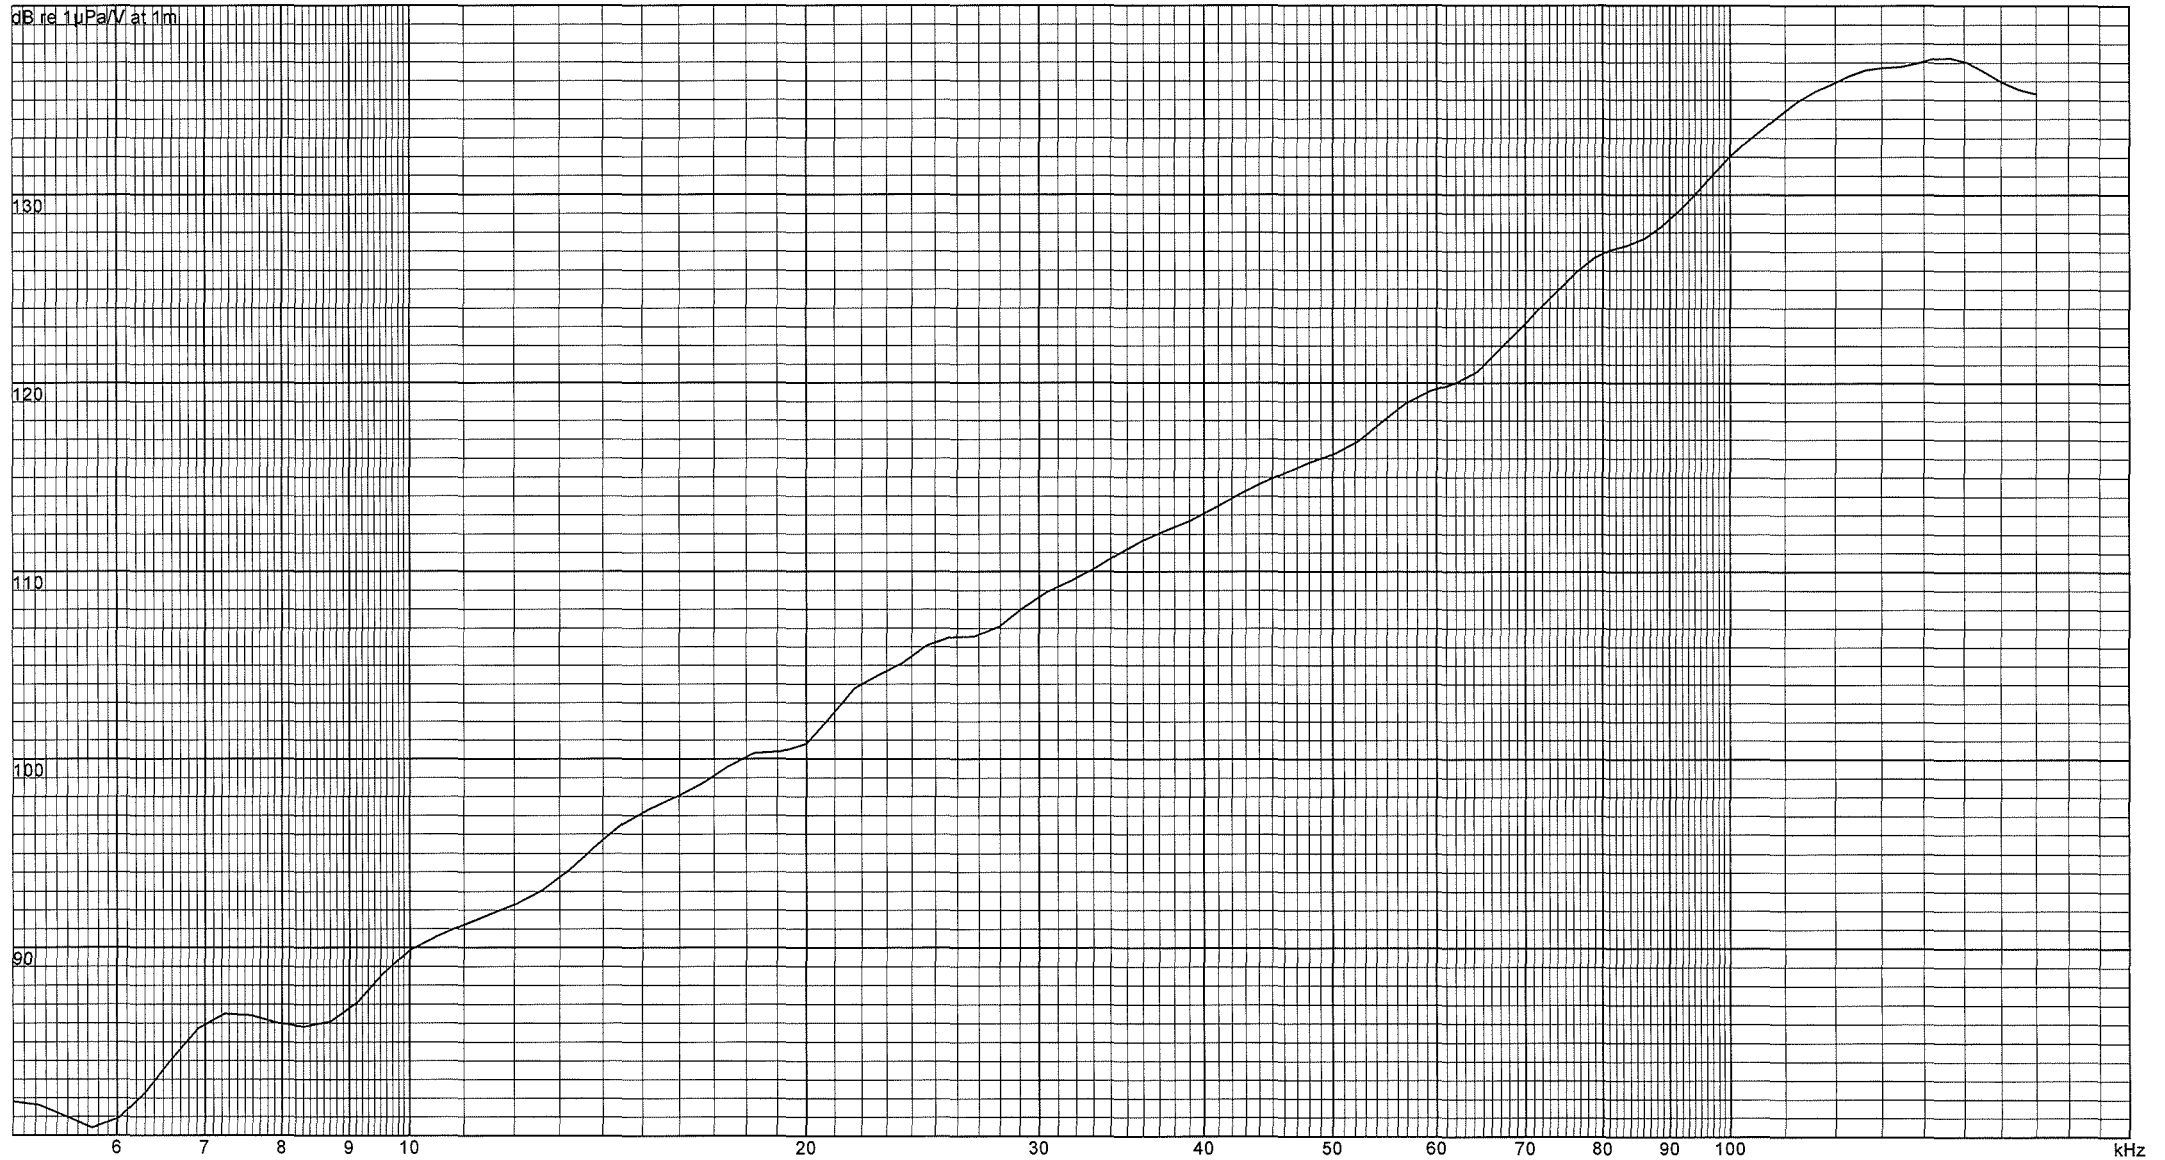



Under Test: TC4013-8
S/N: 1319189

Date: 2019-08-21
Session, Run: 32686, 8
Comment:

IMPEDANCE SUMMARY

Amplitude: 10.0 Vrms
Pulse Width: 3000.0 μ s
Rep Rate: 33.3 ms
Averages: 4

Temperature: 23.17°C
Depth: 1.2 m
Cal Resistor: 0.0 ohms
Tested by: PRA

— 1319189\Impedance\1\Impedance\Try 1
- - - 1319189\Impedance\1\Resistance\Try 1
..... 1319189\Impedance\1\Reactance\Try 1

